

#### HDMI over HDBaseT Extender with IR

# **Operating Instructions**



- Compact design for easy and flexible installation
- $\bullet$  HDCP 2.2 / HDCP 1.4 and DVI 1.0 compliant.
- Supports 18Gbps video bandwidth.
- Single Cat5e/6 cable transmission: 120m @ 4K2K, 150m @ 1080p.
- HDMI loop output on transmitter
- Analogue 3.5mm stereo output on receiver
- Bi-directional IR control (two targets and two emitters included)
- RS232 pass-through
- CEC pass-through
- HDR, HDR10+, Dolby Vision and HLG support
- Supports PoC (Power over Cable)

#### Overview

This 18Gbps HDMI Extender can extend high definition video / audio signal, RS-232, bi-directional IR, and the distance is up to 492ft / 150 meters between transmitter and receiver via a single CAT cable. It supports resolution up to 4K2K@60Hz 4:4:4, 18Gbps and HDCP 2.2. One HDMI loop port is available for output. It also supports de-embeded audio for L/R audio output and PoC function. In addition, the extender is equipped with two-way IR pass-through which allows for source and display control.

This HDMI extender includes two units: transmitter unit and receiver unit. The transmitter unit is responsible for capturing HDMI input signal and carrying the signal via one cost effective Cat5e/6 cable, and transmitting / emitting IR RS232 control signals. The receiver unit is responsible for receiving the HDMI signal and transmitting / emitting IR RS232 control signal. The extender offers the most convenient solution for HDMI extension via a single Cat5e/6 with long distance capability.

#### Package Contents

- 1 x 18Gbps HDMI over HDBaseT Extender (Transmitter)
- 1 x 18Gbps HDMI over HDBaseT Extender (Receiver)
- 1 x IR Blaster cable (1.5 meters)
- 1 x 20~60KHz IR Receiver cable (1.5 meters)
- 2 x 3-pin Phoenix connector
- 1 x 24V/1A Locking Power adapter
- 1 x User Manual

### A 3218C HDMI over HDBaseT Extender with IR

# Specifications


Technical		
HDCP Compliance	HDCP 2.2 / HDCP 1.4	
Video Bandwidth	18Gbps	
Video Resolution	4K2K 50/60Hz 4:4:4 4K2K 50/60Hz 4:2:2 4K2K 50/60Hz 4:2:0 4K2K 30Hz 4:4:4 1080p, 1080i, 720p, 720i, 480p, 480i All HDMI 3D TV formats All PC resolutions including 1920 x 1200	
Color Space	RGB / YCbCr 4:4:4, YCbCr 4:2:2, YCbCr 4:2:0	
Color Depth	8/10/12-bit (1080P60Hz, 4K30Hz, 4K60Hz YCbCr, 4:2:2/4:2:0), 8-bit (4K60Hz 4:4:4)	
HDMI Audio Formats	LPCM 2.0/2.1/5.1/6.1/7.1, Dolby Digital, Dolby TrueHD, Dolby Digital Plus(DD+), DTS-ES, DTS HD Master, DTS HD-HRA, DTS-X	
L/R Audio Formats	PCM 2.0	
ESD Protection	Human body model — ±8kV (Air-gap discharge) & ±4kV (Contact discharge)	
Connection		
Transmitter	Inputs: 1x HDMI Type A [19-pin female] Outputs: 1x HDMI Type A [19-pin female] 1x HDBT OUT [RJ45, 8-pin female] Control: 1x IR IN [3.5mm Stereo Mini-jack] 1x IR OUT [3.5mm Stereo Mini-jack] 1x RS232 [Phoenix jack] 1x SERVICE [Mini-USB, Update port]	
Receiver	Inputs: 1x HDBT IN [RJ45, 8-pin female] Outputs: 1x HDMI Type A [19-pin female] 1x AUDIO OUT [3.5mm Stereo Mini-jack] Control: 1x IR IN [3.5mm Stereo Mini-jack] 1x IR OUT [3.5mm Stereo Mini-jack] 1x RS232 [Phoenix jack] 1x SERVICE [Mini-USB, Update port]	

# **Specifications**

Mechanical				
Housing	Metal Enclosure			
Colour	Black			
Dimensions	Transmitter / Receiver: 140mm [W] x 65mm [D] x 18mm [H]			mm [H]
Weight	Tra	ansmitter: 16	0g, Receiver:	155g
Power Supply			240V 50/60H V/1A (Locking	
Power Consumption	9.3	9.36 W		
Operating Temperature	0 - 40°C			
Storage Temperature	-2	0 - 60°C		
Relative Humidity	20 - 90% RH (no condensation)		on)	
Resolution/Distance				
4K2K	120M			
1080P	150M			
Resolution/Cable Length		4K60	4K30	1080P60
HDMI IN / OUT		5M	10M	15M
The use of "Premium High Speed HDMI" cable is highly recommended.				


### A 3218C HDMI over HDBaseT Extender with IR

# Operation Controls and Functions

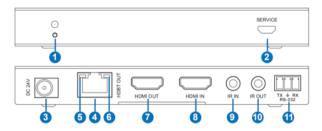

Transmitter Panel		
No.	Name	Function Description
1	Power LED	Red LED indicates that the transmitter is powered on.
2	SERVICE port	Firmware update port.
3	DC 24V	DC 24V/1A power supply input port. Note that the extender supports PoC function, it means that either transmitter or receiver is powered on by 24V/1A power adapter, the other one doesn't need power supply.
4	HDBT OUT	RJ45 connector for connecting the HDBT IN port of receiver with a CAT 5e/6 cable.
5	Connection Signal Indicator lamp	Illuminating: Transmitter and Receiver are in good connection status.     Flashing: Transmitter and Receiver are in poor connection status.     Dark: Transmitter and Receiver are not connected.
6	Data Signal Indicator lamp	Illuminating: HDMI signal with HDCP.     Flashing: HDMI signal without HDCP.     Dark: No HDMI signal.
7	HDMI OUT	HDMI loop output for display.

8	HDMI IN	HDMI source input.
9	IR IN	IR input port for receiving the signal of IR remote.
10	IR OUT	IR output port for control of source device. This IR output signal is from the IR IN port of receiver.
11	RS-232	3-pin Phoenix connector for RS-232 command transmission. The RS-232 command will pass-through from transmitter to receiver or from receiver to transmitter.

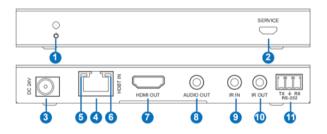


Rece	Receiver Panel		
No.	Name	Function Description	
1	Power LED	Red LED indicates that the receiver is powered on.	
2	SERVICE port	Firmware update port.	
3	DC 24V	DC 24V/1A power supply input port. Note that the extender supports PoC function, it means that either transmitter or receiver is powered on by 24V/1A power adapter, the other one doesn't need power supply.	
4	HDBT OUT	RJ45 connector for connecting the HDBT OUT port of transmitter with a CAT 5e/6 cable.	

#### A 3218C HDMI over HDBaseT Extender with IR

5	Connection Signal Indicator lamp	Illuminating: Transmitter and Receiver are in good connection status.     Flashing: Transmitter and Receiver are in poor connection status.     Dark: Transmitter and Receiver are not connected.
6	Data Signal Indicator lamp	Illuminating: HDMI signal with HDCP.     Flashing: HDMI signal without HDCP.     Dark: No HDMI signal.
7	HDMI OUT	HDMI output for display.
8	AUDIO OUT	3.5mm stereo connector for analog audio output.
9	IR IN	IR input port for receiving the signal of IR remote.
10	IR OUT	IR output port for control of display device. This IR output signal is from the IR IN port of transmitter.
11	RS-232	3-pin Phoenix connector for RS-232 command transmission. The RS-232 command will pass-through from transmitter to receiver or from receiver to transmitter.

#### IR cable use method

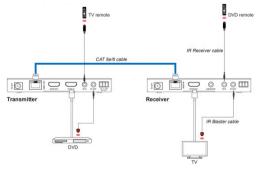

Note: When the angle between the IR receiver and the remote control is  $\pm$  45 °, the transmission distance is 0-5 metres; when the angle between the IR receiver and the remote control is  $\pm$  90 °, the transmission distance is 0-8 metres.

### **Application Diagram**

